




Kombinirani držači za nasadna glodala i glodaće glave DIN6358

Kombi-Aufsteckfräserdorne mit Längs- oder Quernut DIN6358
 Combi shell mill holders for cutters with longitudinal or transverse drive
 Mandrins porte-fraises double usage

MAS-BT 403

Isporuka : sa ugrađenim klinom, povlačnim prstenom te križnim vijkom
 Lieferumfang : mit Paßfeder, Mitnehmerring und Fräseranzugschraube
 Delivery : with driving key, driving ring and cross screw
 Livraison : avec entraineur, clavette et vis cruciforme

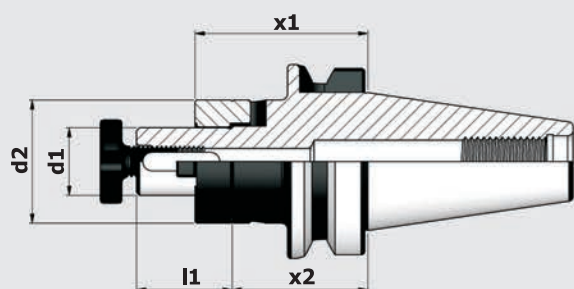

Konus	d1	x1	x2	d2	l2	code
Kegel	16	55	45	32	27	KD16.B40.055
Taper	16	100	90	32	27	KD16.B40.100
Cone	16	150	140	32	27	KD16.B40.150
40						
MAS-BT AD	22	55	43	40	31	KD22.B40.055
	22	100	88	40	31	KD22.B40.100
	22	150	138	40	31	KD22.B40.150
	27	55	43	48	33	KD27.B40.055
	27	100	88	48	33	KD27.B40.100
	27	150	138	48	33	KD27.B40.150
G6,3 15.000	32	60	46	58	38	KD32.B40.060
	32	100	86	58	38	KD32.B40.100
	32	150	136	58	38	KD32.B40.150
	40	60	46	70	41	KD40.B40.060
	40	100	86	70	41	KD40.B40.100
	40	150	136	70	41	KD40.B40.150

Konus	d1	x1	x2	d2	l2	MAS-BT403
Kegel	16	70	45	32	27	KD16.B50.070
Taper	16	100	90	32	27	KD16.B50.100
Cone	16	150	140	32	27	KD16.B50.150
50						
MAS-BT AD	22	70	43	40	31	KD22.B50.070
	22	100	88	40	31	KD22.B50.100
	22	150	138	40	31	KD22.B50.150
	22	200	188	40	31	KD22.B50.200
	27	70	43	48	33	KD27.B50.070
	27	100	88	48	33	KD27.B50.100
G6,3 15.000	27	150	138	48	33	KD27.B50.150
	27	200	188	48	33	KD27.B50.200
	32	70	46	58	38	KD32.B50.070
	32	100	86	58	38	KD32.B50.100
	32	150	136	58	38	KD32.B50.150
	32	200	186	58	38	KD32.B50.200
	40	70	46	70	41	KD40.B50.070
	40	100	86	70	41	KD40.B50.100
	40	150	136	70	41	KD40.B50.150
	40	200	186	70	41	KD40.B50.200
	50	70	54	90	46	KD50.B50.070

Rezervni dijelovi/ Ersatzteile/ Spare parts/ Accessoires

d1	code
16	D6366.16
22	D6366.22
27	D6366.27
32	D6366.32
40	D6366.40
50	D6366.50



d1	code
16	D6367.M08
22	D6367.M10
27	D6367.M12
32	D6367.M16
40	D6367.M20
50	D6367.M24



d1	code
16	UP.04420
22	UP.06622
27	UP.07725
32	UP.08730
40	UP.10832
50	UP.12836

